



SB, Incorrect deck belt length, McCulloch CRD units with 97cm deck, M125-97TC, M145-97TC, M165-97TC, 2019-04

Affected models

Model	PNC	Serial Range	
		Start	End
M125-97TC PowerDrive	960510149	112618DXXXXXX	032219DXXXXXX
M145-97TC PowerDrive	960510150	112618DXXXXXX	032219DXXXXXX
M165-97TC Classic	960510166	112618DXXXXXX	032219DXXXXXX

Affected markets

Europe.

Description

The belt installed on the deck may be too short for proper operation and can cause excessive friction on the pulleys. This can lead to belt squealing, smell of burning rubber and/or smoke and could potentially cause damage to the belt.

Action

	Product sold to end user	Residual inventory not yet sold
What is required:	Service is required	Service is required
When to do:	Only if encountered	At Pre-Delivery Inspection
What to do:	Inspect unit for proper belt function	
How to do:	See Additional information	

Parts information

Replacement part no.	Part description	Quantity	Old part no.
597122201	Belt 97 Manual	1	N/A

Warranty reporting information

Normal warranty rules apply. A warranty claim must be filed for each unit serviced, even if service is labor only. Please include full serial number. All claims must be sent through our warranty process using only the information listed below:



Field	Selection or Entry
Claim type (inventory)	4 - Requested by Factory
Claim type (end users)	1 - Warranty
Failure description	B2190001A
Component code	802 Belts
Defect code	92 Part exchanged on request by Husqvarna
Labor allowance	3 units (18 minutes)

Additional information

Inspecting unit for proper deck belt operation

Tools/Equipment needed:

- Reference owner's manual for tools required for initial set up

Step 1. Follow the owner's manual instructions to install steering wheel, seat and battery.

Step 2. Fill fuel tank with enough fresh fuel to run for 20 minutes.

Step 3. Ensure the unit is on flat ground and the blades can safely turn without striking any objects or debris.

Step 3. Start the unit per the instructions identified in the owner's manual.

Step 4. Lower the deck height to the #3 position, press the brake pedal in and set the parking brake.

Step 5. With the throttle control in fast position engage the blades for 30 seconds, then disengage.

Step 6. With the blades disengaged and the engine running raise the deck level to position #6 and monitor for belt squealing or rubber burning smell for the next 15 minutes.

Step 7a. If belt squealing or rubber burning smell is identified, stop the inspection and replace the deck belt per the owner's manual instructions. File additional warranty claim referencing belt was replaced per SB2190001A.

Step 7b. If belt squealing or rubber burning smell is not identified, no further action is required.

Revision History

Rev.	Date	Order id.	Description
A	4/2/19	SB-4212	Created